



Technical Bulletin

Subject: Horn, Sound is Distorted


Group: 90

Number: 97-03

Model(s): EuroVan

► VIN 70_VH075829

Date: Sept. 30, 1997

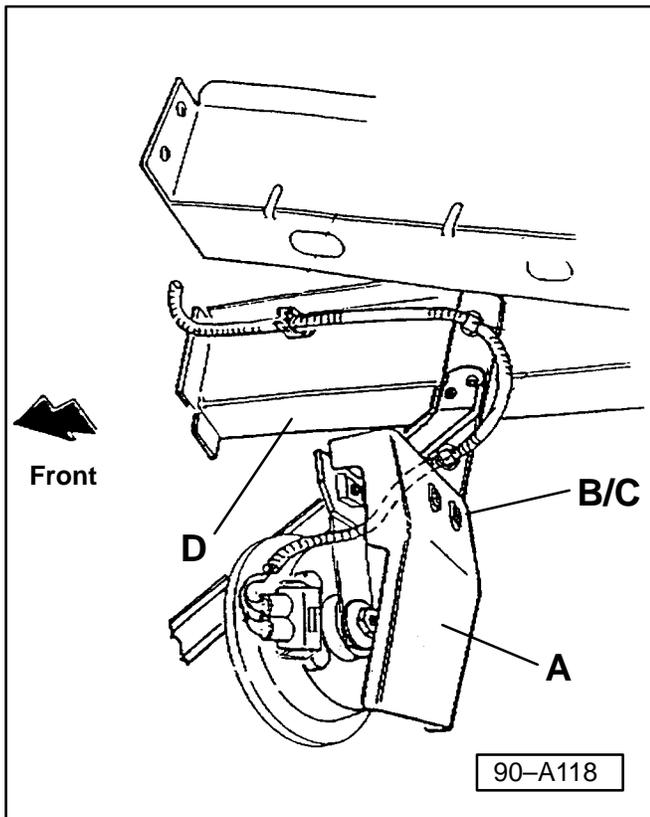

Condition

Horn, sound is distorted.

May be caused by water in horn.

Production

Installation of additional splash shield beginning 11.96 with VIN 70_VH075830.

Service

If condition exists:

- Replace horn.
- Install splash shield -A- below long member using the following parts.

Item	Description	Part No.
A	Splash Shield	701 951 203
B	Screw Washer	N 013 967 1 N 904 995 01
C	Nut	N 045 427 1
D	Long member	NPN

When procedure applies to vehicles within The New Vehicle Limited Warranty and adheres to Warranty Policy guidelines, use the following:

Part Identifier: 9052

Labor Operation: 9052110