



# Technical Bulletin

Subject: **CD Changer, Grounding**

Group: **91**

Number: **95-04**

Date: **Oct. 5, 1995**

Model(s): **All with Panasonic CD Changer**

## Condition

Noise while using the CD changer can be caused by the installation of an additional ground wire.

## Service

Installation instructions included with the Panasonic CD changer show that an additional ground wire should be connected to the CD changer.

This ground wire can introduce noise into the system and is not necessary for the CD changer to function.

If a vehicle exhibits the above condition:

- Using the following illustrations as a guide, inspect for the additional ground wire in the locations shown.
- Remove additional ground wire.




### Note:

**When installing NEW CD changers DO NOT install this additional ground wire.**

**When procedure applies to vehicles within warranty use the following:**

**Part Identifier: 9160**

**Labor Operation: 9160510 20 TU**

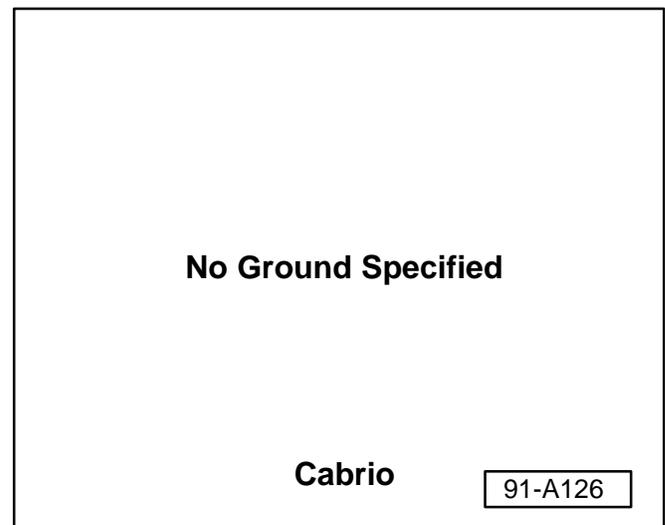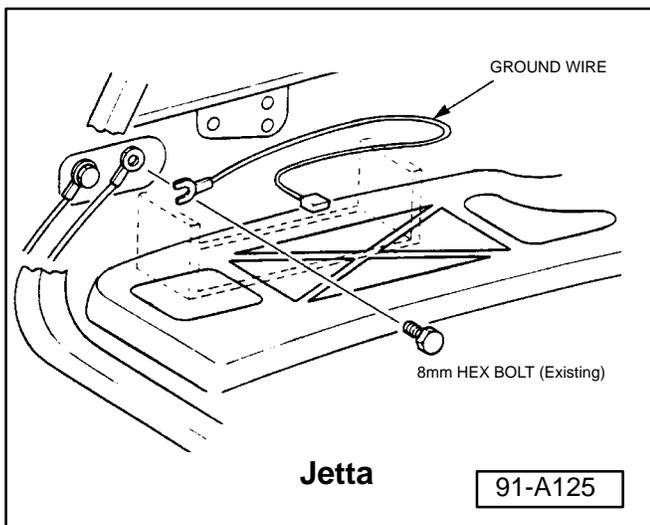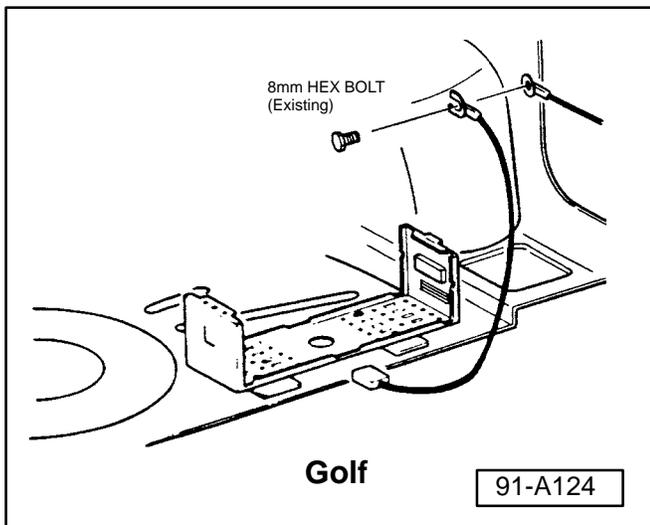



# Technical Bulletin

