



Important!

Please give copies to all your VW Technicians

Technical Bulletin


Subject: Speed Sensors, Locating on Transmission and Associated Diagnostic Trouble Codes

Group: 01

Number: 99-02

Model(s): All with 01M Automatic Transmission

Date: Mar. 31, 1999

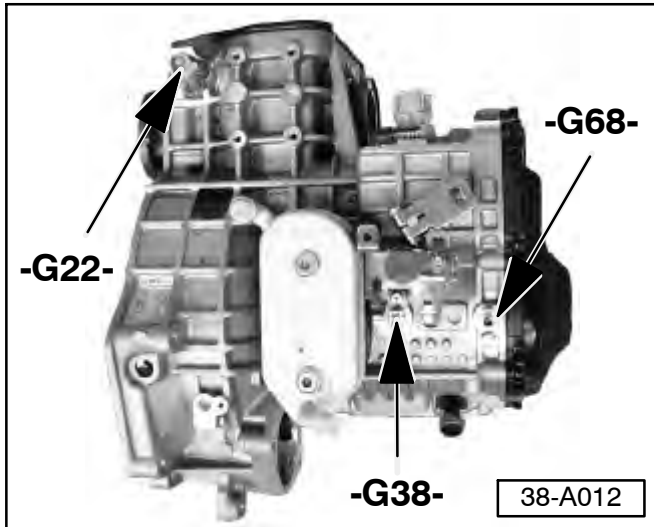

Service

◀ Use illustration to identify transmission Vehicle Speed Sensor (VSS) -G38-, Vehicle Speed Sensor (VSS) -G68- and Speedometer Vehicle Speed Sensor (VSS) -G22-.

The associated Diagnostic Trouble Codes (DTC) and Part Identifiers are listed below.

Engine Control Module		
DTC	Sensor	Part Identifier
00281* (engine OBDI)	-G22-	9009
16885 (engine OBDII)		

* VAG 1551 Scan Tool (ST) incorrectly shows -G68- actual component is -G22-.

Transmission Control Module		
DTC	Sensor	Part Identifier
00297	-G38-	3726
00281	-G68-	3732

Instrument Cluster		
DTC	Sensor	Part Identifier
01086	-G22-	9009

C 01-99-02